

875 Bassett Road Westlake, Ohio 44145 | USA (800) 817-7890 Westernenterprises.com

User Manual



Manufacturer of innovative compressed gas fittings, meriam* regulators & measurement tool..

M1000 Digital Calibrator

0 % to 110 % of FS \pm (0.02 % of FS + 0.005 % of Rdg)



Contents

General Information	4
Notification Statements	4
Glossary	5
General warnings and cautions	6
Preventing injury	6
Safety symbols	6
Sample label for General Purpose digital calibrators	57
Fire or explosion hazard	7
For General Purpose Series	7
Do not exceed pressure limits	8
Sensors	9
Customer calibration	11
Calibrate the M1000 by using the keypad:	11
1. User Zero	11
2. Restore Factory Calibration	13
3. User Span (Respan)	13
Digital calibrator	15
Battery	15
Batteries	15
The display	17
Keypad: Description of the keys	18
The backlight	20
Measurement units	21
Auto Off (Automatic shut off)	21
What does the Zero (ø) key do?	22
Specifications	23
Sensors: type and range	23
Temperature	23
Relative Humidity	23
Vibration	23
Ingress specifications	24
Altitude specifications	24
Keypad	24
Media compatibility	24
Battery type	24
EMC compliance	25
Dimensional specifications	26
Weight	26
Enclosure	26
Maintenance and cleaning	27
Cleaning	27
Prepare the digital calibrator for storage	27

Help		28
	Register your product	28
		28
Wester	rn Contact Information	29
	Contact us	29
	Repair or Calibration	30

General Information

Notification Statements

Disclaimer

Every precaution has been taken in the preparation of this manual. Nevertheless, Meriam assumes no responsibility for errors or omissions or any damages resulting from the use of the information contained in this publication, including, without limitation, incidental, special, direct or consequential damages. MERIAM MAKES NO REPRESENTATIONS OR WARRANTIES WITH RESPECT TO THE ACCURACY OR COMPLETENESS OF THE CONTENTS HEREOF AND SPECIFICALLY DISCLAIMS ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR ANY PARTICULAR PURPOSE. Meriam reserves the right to revise this publication and to make changes from time to time in the content hereof without obligation to notify any person of such revision or changes.

In no event shall Meriam be liable for any indirect, special, incidental, consequential, or punitive damages or for any lost profits arising out of or relating to any services provided by Meriam or its affiliates.

It is not possible for Meriam to identify all foreseeable uses or misuses, therefore all persons involved in commissioning, using, or maintaining this product must satisfy their self that each intended application is acceptable.

Copyright

This publication is proprietary to Meriam and no ownership rights are transferred. Neither this manual, nor any of the material contained herein, may be reproduced without the prior written consent of Meriam.

Trademark information

Design Patent D769,141 for the digital calibrator's LCD display.

All other trademarks are the property of their respective owners.

Glossary

Words and phrases with their definitions or explanations.

Words & phrases	Definitions or explanations
Blinking	 It indicates the active edit field on an edit screen. It indicates the displayed value is not actively changing (like Hold or stopped Test).
FS	FS is the abbreviation of Full Scale.
Home	 Home is the first screen that displays after turning on the digital calibrator. It's the screen with measurements and units on it. After you press the Home key in many other screens, the digital calibrator returns you to Home.
Key and button	 A key refers to hardware push-buttons on the keypad that you can press. A button refers to an area in meriSuite CG that you can tap or click to select functions.
Isolated	• The word <i>isolated</i> refers to the sensing element being separated from the media. It is commonly used in the phrases Absolute Isolated (AI) pressure and Compound Isolated (CI) pressure.
Customer Calibration	 Customer calibration refers to any calibration done outside of Meriam with non-Meriam traceability. Customer calibration includes: Multipoint calibration or adjustment.

General warnings and cautions

Preventing injury

Failure to follow all instructions could result in injury:

- Read the entire manual before using the digital calibrator.
- Understand the contents before using the digital calibrator.
- Follow all safety warnings and instructions provided with this product.

Safety symbols

The following table defines the safety symbols, signal words, and corresponding safety messages used in the manual. These symbols:

- Identify potential hazards.
- Warn you about hazards that could result in personal injury or equipment damage.

Safety symbols	Explaining the symbols
Read directions before using	This is the <i>Read directions before using</i> symbol. This symbol indicates that you must read the instruction manual.
△ DANGER	Indicates a potentially hazardous situation which, if not avoided, will result in death or serious injury.
<u>↑</u> WARNING	Indicates a potentially hazardous situation which, if not avoided, could result in death or serious injury.
△ CAUTION	Indicates a potentially hazardous situation which, if not avoided, could result in minor or moderate injury.
NOTICE	Indicates information essential for proper product installation, operation or maintenance.

Sample label for General Purpose digital calibrators

All M1000 Series models are available for general-purpose use.

General Purpose (GP) versions are identified by the name plate located on the rear of the unit under the protective rubber boot. A sample of the General Purpose name plate is shown below:



Fire or explosion hazard

A DANGER

- Do not use General Purpose versions in hazardous areas.
- Do not use General Purpose versions in areas that may contain flammable gas or vapors, combustible dusts or ignitable fibers where an unintended spark can cause a fire or explosion.

For General Purpose Series

△CAUTION

Substitution of components may impair operation and safety.

- Disconnect power before servicing.
- Do not power the digital calibrator with a combination of new and old batteries.
- Do not power the digital calibrator with a combination of batteries from different manufacturers.

Do not exceed pressure limits

∴WARNING

- Do not exceed the Pressure Limits listed in the Specifications section of this manual.
- Failure to operate within the specified pressure limit could result in minor or moderate injury.

Sensors

Use two wrenches to install or remove pressure connections Connection: 1/8" female NPT, 316L SS.

- Always use a 3/4 in. wrench on the pressure manifold when you install or remove the 1/8 in. NPT fitting.
- Applying torque to the manifold can damage the plastic enclosure and voids the warranty.
- Do not over tighten.

Carefully equalize the pressure

Avoid these two issues with differential sensors:

- Connecting pressure to the incorrect pressure port on DN differential pressure modules may cause damage to the pressure sensor.
- 2. Applying pressure to either port before both connections are made.


NOTICE

Apply pressure to both differential ports at the same time.


Note: See Overrange limit in the section called Specifications concerning overrange pressure limits. If over pressure damage occurs, you must return the digital calibrator to the factory for sensor replacement.

Sensor manifold types


ZM1000-CNXXXX



ZM1000-DNXXXX



ZM1000-ANXXXX



Customer calibration

Calibrate the M1000 by using the keypad:

You can calibrate the digital calibrator in the field for these three types of calibration:

- 1. User Zero. (Zero key)
- 2. Restore Factory Calibration. (RESTORE FACTORY CAL)
- 3. User Span (RESPAN).

1. User Zero

How to zero Absolute Sensors

Overview of the zeroing Absolute Sensors

The digital calibrator is a stable and precise instrument. However, on occasion the digital calibrator should have a new zero taken. The new zero removes a zero drift that can occur after the digital calibrator was last zeroed. The digital calibrator can be zeroed only if the new applied zero is within \pm 1 % FS of the original factory calibration zero. This prevents accidental zeroing at atmospheric pressure or other relatively high pressures. If the digital calibrator is outside this limit, the calibrator cannot zero.

- Referenced to Absolute Zero This traditional and preferred method takes a snapshot of the measured pressure when a vacuum of less than 100 microns Absolute is applied to the sensor.
- 2. **Restore Factory Zero** This method restores the calibration curve to the original zero taken at the factory.

Note: This feature is intended for comparison purposes, and should not be used for real pressure measurement. This feature does not compensate for any zero drift.

3. User Defined Offset (Zero) - With this method, you can enter any pressure value when a known reference is applied (for example, the local barometer). The digital calibrator compares its actual measured value with the entered value, and calculate a new zero reference based on the offset.

Steps for zeroing Absolute Sensors

You can zero the digital calibrator in one of three ways. The following may appear in a different order depending on which arrow key you press. When an absolute sensor displays on-screen, press the **Zero** key to see one of the three sets of characters below and the following three messages

On-screen message	Explanations
TRP √ TO CHOOSE REF	 Tapping the Accept key selects the displayed reference.
ARROWS TO CHANGE REF	 Tapping an Arrow key changes the displayed reference.
X CANCELS	 Tapping the Cancel key cancels the zero request.
AP2 0	 This is the on-screen abbreviation for Absolute Zero.
dFLE	 This is the on-screen abbreviation for Default. If you want to restore the Factory Zero on a sensor, press the Accept key when you see these characters appear.
15E- D	 This refers to User Defined Offset (Zero). You can set an absolute reference point other than zero.

How to zero Differential or Compound sensors

- 1. Disconnect from a pressure source and vent the pressure port to atmosphere.
 - 1. Do not remove the factory installed P2 plug if it is present.
 - 2. The display should read close to zero.
- 2. Press the **Zero** key.

 The top line displays dashes -----.
- 3. The process is complete when the digital calibrator returns to the **Home** (Measurement Units) screen.

Note: You can only zero the digital calibrator if the new zero value is within \pm 5 % (of FS) of the original factory calibrated zero. If the zero procedure generates a new zero reference outside this limit, the procedure fails. Factory service may be required.

2. Restore Factory Calibration

- 2. Tapping √ key asks you to confirm that you want to restore the calibration: COMMIT FACT CAL? YES-√ NO-X.
 - Tapping the √ key for YES restores the Factory Calibration and it removes any calibration you may have entered and it takes you back to FACTORY CAL TAP √ TO RESTORE screen. Tap the **Home** key to exit.
 - Tapping the X key for NO stops the Restore Factory
 Calibration and it takes you back to FACTORY CAL TAP ✓
 TO RESTORE screen. Tap the **Home** key to exit.



3. User Span (Respan)

The √ refers to the **Accept** key, the following key



- 2. After tapping the √ key, you see two lines of information display:
 - 1. A suggested reference pressure of **070.00** in large characters. This refers to 70 % Full Scale.
 - APPLY REFERENCE PRESSURE √-CONTINUE X-CANCELS.
- 3. After tapping ✓ to continue, the first character flashes on the screen because you are in edit mode.
 - 1. Use up or down arrow keys to change the value.
 - 2. Or, use the right key to move to the value you need to change.
- After editing the value, you see:
 ENTER PRESSURE TAP √-FINISH X-CANCELS

- Tapping √-FINISH accepts the pressure you entered and takes you back to the RESPAN TAP ✓ TO BEGIN. Tap the Home key to exit RESPAN.
- 2. You can tap the X-CANCELS at any time to stop.



Note: The **Units** key is turned off during RESPAN.

Digital calibrator

Battery

When you turn on the digital calibrator, it draws power from the batteries and the battery icon displays in the bottom row. When you press the information button, it displays **Batt %**.

Batteries

A DANGER

Remove and replace batteries in non-hazardous (safe) areas only.

Turn off the backlight

- Turn off the backlight when you need to conserve battery power.
- The backlight is dimmed when the digital calibrator is in low battery mode.

Suggested brands of batteries

The following is a suggested list of batteries.

- Duracell MN1500
- Duracell PC1500
- Energizer EN91
- Panasonic LR6XWA
- Rayovac 815
- Varta 4906

Note: The digital calibrator is powered by four 1.5 volt AA size batteries.

Know your batteries

- Never mix batteries—not by manufacturer or by size, by capacity, or by chemistry.
- Never mix old and new batteries.
- Remove all four batteries in the digital calibrator at the same time.
- Replace all four batteries with batteries from the same package or with the same expiration date.

Install the batteries

- 1. Turn over the digital calibrator so the display faces down.
- 2. Remove the two screws on the battery cover with the Phillipshead screwdriver by turning them counterclockwise.
- 3. Insert the four AA batteries.

Note: Pay attention to the positive (+) and negative (-) battery polarity markings at the bottom of the compartment.

- 4. Replace the battery cover.
- 5. To secure the cover, torque the screws clockwise 2 in. lbs. maximum.
- 6. Do not over tighten.

NOTICE

To prevent internal damage to circuitry, do not substitute screws with lengths that are different from the screws Meriam provided to you.

Watch for the low battery indicator


The battery indicator on the display shows the current charge.

Note: Be prepared to change batteries when you see the outline of the battery icon and the outline of the battery icon flashes. You have approximately 2 hours of run time following a low battery warning.

Refer to battery manufacturers' instructions

Visit the website of the battery manufacturer to learn more about the care, storage, shipping, use, disposal, and recycling of your batteries.

The display

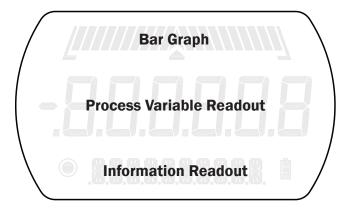

The bar graph

The bar graph displays a live indication of the current pressure or temperature applied to a sensor as a percent of FS.

Note: When you press the Information key, the bar graph displays the remaining state of the charge for the batteries.

Display functions

The digital calibrator has six display functions.

Press the **Forward** (or **Backward** in reverse order) key to view these modes.

- 1. **Home** is the default view with measurement units.
- 2. MIN (Minimum).
- 3. MAX (Maximum).
- 4. AVG (Average).
- 5. FACTORY CAL(ibration) TAP ✓ TO RESTORE.
- 6. **RESPAN TAP ✓ TO BEGIN.**

Keypad: Description of the keys

Name	Key	Description
Backward		 It cycles backward through menu options.
Home		 Home key returns you to the Measurement and Units screen. Home key is disabled during tests and edits
Forward		It cycles forward through menu options.
Units		Select a measurement unit.
Release Hold		It releases the Hold .
Hold		It begins a Hold .
Up arrow		It increases digits by one.
Left arrow		 It moves the blinking cursor one space at a time to the left.
Zero	Ø	Zero key resets pressure values to zero.It resets min max values.
Dight orrow		It sets edit values to zero.
Right arrow		 It moves the blinking cursor one space at a time to the right.
Down Arrow		It decreases digits by one.
Cancel or Esc	X	 Cancel any editing or changes without saving. It also stops tests.
Accept	~	 Accept applies all editing and changes, and then saves them. It also stops tests.
Power	O	Turns the digital calibrator on or off.
Information	i	 Displays information about the digital calibrator, internal sensor, and the firmware.
Backlight	*	It provides on and off only.

The Information key and the Home screen

The Information menu provides you with details about the digital calibrator and sensors.



- 1. Batt % displays the percentage on the bar graph and in digits.
- 2. Indicates sensor type (or measurement type): compound, absolute, or differential.
- 3. CAL DATE
- 4. **USL** is an abbreviation for *upper sensor limit*.
- 5. **LSL** is an abbreviation for *lower sensor limit*.
- 6. **LT MAX** % displays the Life-Time Maximum that has been reached on the sensor.
- 7. **SENSOR F/W VERS** (F/W is an abbreviation for *firmware*) [this message scrolls to display the information]
- 8. **SENSOR S/N** (S/N is an abbreviation for *serial number*) [this message scrolls to display the information]
- 9. **DEV F/W VER** (DEV is an abbreviation for *device*; it refers to the digital calibrator) [this message scrolls to display the information]
- 10. **DEV S/N** [this message scrolls to display the information]

Up and Down Arrows

 In the edit mode, the Up Arrow increases the digit each time you press it. The Down Arrow decreases the digit



- 1. **Up Arrow:** 0 to 1 to 2 to 3 to 4 to 5 to 6 to 7 to 8 to 9.
- 2. **Down Arrow:** -0 to -1 to -2 to -3 to -4 to -5 to -6 to -7 to -8 to -9.
- 3. The negative symbol in the display appears in front of the first digit when it is required.

The backlight

White backlight

The white backlight has an automatic time out. If you do not press any keys while the backlight is on, it automatically turns off.

Backlight

Press the Backlight key to cycle through: On or Off.

Flashing red backlight

The flashing red backlight indicates an error condition. Possible error conditions are:

- Pressure has exceeded the calibrated accuracy of the digital calibrator
- Pressure has fallen below the stated accuracy of the digital calibrator.

Note: The red backlight overrides the white backlight.

Overrange condition

During an error or overrange condition, the red backlight **overrides** the white backlight.

However, once the error or overrange condition is corrected, the white backlight is restored to its previous state (if the backlight **Auto Off** timeout did not expire).

Measurement units

A measurement unit doesn't display

NOTICE

If a given measurement unit cannot display the correct number of digits, the digital calibrator automatically advances to the next displayable unit.

Note: When you turn on the digital calibrator, it defaults to the last selected measurement unit.

Measurement units are stored on a sensor

When the digital calibrator is shipped, eight (8) measurement units are active. See the following list.

Standard Measurement Units (non-custom)		
1. PSI	4. INHG0C	7. BAR
2. INW20C	5. MMHG0C	8. MBAR
3. MMW20C	6. KPA	

Auto Off (Automatic shut off)

How long will the digital calibrator remain on if I leave it unattended?

The default setting is 30 minutes.

What does the Zero (ø) key do?

In normal measure mode

If the sensor is within a tolerance band around zero, press and hold the **Zero** key to zero the pressure measurement and to reset the Min and Max measurements.

Note: The tolerance band is approximately \pm 1 % of the FS pressure value of the sensor.

In Min or Max mode

Press and hold the **Zero** key to reset the MIN and MAX measurement. However, this does not zero the pressure measurement.

In Average mode

Press and hold the **Zero** key to restart the rolling average.

Holding the Zero key

The key must be held to perform the Zero mode. The displayed value(s) dashes out during the zero process.

Specifications

Sensors: type and range

Non-Isolated

Model number	Pressure	ran	ge
Absolute Non-Isolate	ed (AN)		
ZM1000-AN0015	0 psi	to	15 psi
ZM1000-AN0030	0 psi	to	30 psi
ZM1000-AN0100	0 psi	to	100 psi
Compound Non-Isol	ated (CN)		
ZM1000-CN0001	-1 psi	to	1 psi
ZM1000-CN0005	-5 psi	to	5 psi
ZM1000-CN0015	-14.5 psi	to	15 psi
ZM1000-CN0030	-14.5 psi	to	30 psi
ZM1000-CN0050	-14.5 psi	to	50 psi
ZM1000-CN0100	-14.5 psi	to	100 psi
Differential Non-Isolated (DN)			
ZM1000-DN0001	-1 psi	to	1 psi
ZM1000-DN0005	-5 psi	to	5 psi
ZM1000-DN0015	-14.5 psi	to	15 psi
ZM1000-DN0030	-14.5 psi	to	30 psi
ZM1000-DN0050	-14.5 psi	to	50 psi
ZM1000-DN0100	-14.5 psi	to	100 psi

Pressure measurements

- 0 % to 110 % of FS \pm (0.02 % of FS + 0.005 % of Rdg).
- For Compound sensors only:
 - Vacuum ± (0.02 % of FS)
 - Vacuum = -14.5 psi
- Accuracy statements include the combined effects of linearity, repeatability, hysteresis, and temperature over the specified operating temperature range.
- Warm up time: 5 minutes.
- You should zero the sensor at working ambient temperature before using it.

Temperature

Storage: -20 °C to 70 °C (-4 °F to 158 °F)
 Operating: -10 °C to 50 °C (14 °F to 122 °F)

Relative Humidity

• 95 % non- condensing.

Vibration

1 meter drop test

Ingress specifications

IP52 for the M1000

Altitude specifications

NOTICE

Do not use the M1000 digital calibrator at an altitude above 2000 m (6561 ft.).

Keypad

Sealed membrane 16 domes.

Media compatibility

Pressure types

- DN: Differential pressure, non-isolated sensors for use with clean, dry, non-corrosive gases only.
- CN: Compound non-isolated sensors for use with clean, dry, non-corrosive gases only.
- AN: Absolute non-isolated sensors for use with clean, dry, non-corrosive gases only.

Pressure limits

- DN units: 2x range when pressurized on high side only. 150 psi (10.5 kg/cm²) static when applied to both sides of sensor simultaneously.
- **CN and AN units:** 3x range or 200 psi, whichever is less.

Battery type

4 AA alkaline batteries of the same battery type.

EMC compliance



Conformity to EN 61326-1:2016

This product has been evaluated to EN 61326-1:2016 the EMC General requirements for electrical equipment for measurement, control and laboratory use. This evaluation demonstrated that when the product is exposed to Radiated Radio Frequency energy in the frequency range 130-1000 MHz and 1.6-2.1 GHz, the pressure and temperature readings may fluctuate beyond the published tolerance of each respective value being measured. In the event of such a phenomenon occurring, the operator should move away from (or have removed) any source of strong RF emissions such as radio transmitters, cell-phones, etc., and repeat the measurement, or reconnect to a PC.

Electrostatic discharge (ESD)

This unit is sensitive to ESD discharges that may result in the unit re-starting of the operating system, or interruption of a PC connection. In the unlikely event of such an occurrence, users should ensure they discharge any static charge they may be carrying by touching a known grounded conductive surface prior to operating the equipment .

Dimensional specifications



Weight

1000 g (35.2 oz. or 2.2 lbs.)

Enclosure

Polycarbonate/ABS alloy

Maintenance and cleaning

Cleaning

• Clean the MTS and its cable with a soft, damp cloth.

Prepare the digital calibrator for storage

Remove the batteries to store the digital calibrator

- We recommend that you remove the batteries from the digital calibrator if you are storing it for an extended time period.
- Follow the battery manufacturer's instructions for storing your batteries.

Store the digital calibrator

 The recommended storage temperature for the digital calibrator is between: -20 °C to 70 °C (-4 °F to 158 °F)

Help

Register your product

We want you to get the most out of your purchase, and that starts with a few, easy registration steps.

- 1. Go to www.meriam.com
- 2. In the Product Registration section, click Register a product.

Find downloads and documents

- 1. Go to www.meriam.com.
- 2. In the Technical Resources section, click Learn More.
- 3. Select one of these categories to find the files you need:

Product manuals | User Manuals and Quick Start Guides

Downloads | Applications (software), firmware, updates, installation instructions

Certifications | Certifications and approvals

SDS (MSDS) | Safety Data Sheets

Control Drawings | Intrinsically Safe Drawings

Western Contact Information

Contact us

Address

Western/Scott Fetzer Co. 875 Bassett Road Westlake Ohio 44145 USA

Telephone

US customers (800) 817-7849
 International customers + 1 216 281 1100

Fax

US & International customers + 1 216 281 0228

E-mail addresses

- Return Material Authorization & Service & Repair Department returnforms@westernenterprises.com
- Sales Department
 <u>meriamsales@westernenterprises.com</u>

Website

meriam.com

Find a local Meriam representative

Use this map to help you find a Meriam representative.

http://www.meriam.com/representatives-map/

9R723-C April 2020

Repair or Calibration

If the device cannot be zeroed, calibrated, or is damaged, it must be returned to the factory for servicing.

First — Request a number

In the event that a device requires service and must be returned, please contact Meriam using one of the methods listed in the following table to request a Return Material Authorization (RMA) number.

Method	Provide the following information
Website	http://www.meriam.com/resources/service-repair- authorization/ Complete the information online and submit the form.
Fax	If you printed and completed the Service & Repair Authorization form, then fax it to: US and International Customers + 1 216 281 0228
Email	 We need the following information in the email: Look on the product label to find the model number & the serial number. Give a brief description of the problem. Send the e-mail to: returnforms@westernenterprises.com

Return Material Authorization

- Do not send any unit for repair unless you contacted Meriam for a Return Material Authorization (RMA) number.
- Important: If you have not received this number and have not clearly marked it on the package being shipped back, we will return the unit at your expense.
- The Meriam Service & Repair Department will provide you with this number when you complete the website form, fax or e-mail your information.
- An RMA number must accompany all incoming packages to insure proper tracking, processing, and repair work.

Questions? Call Meriam

US Customers......(800) 817-7849 International Customers......+ 1 216 281 1100

Ship the box to

Western/Scott Fetzer co. 10920 Madison Avenue Cleveland Ohio 44102 USA